

25

Date: Friday, 5/25/2007 8:12:52 AM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206 A/B HIGH GEAR SKIDTUBE
Job Number	: 32567	Part Number	: D206642212
Estimate Number	: 10170	Drawing Number	: N/A
P.O. Number	: N/A	Project Number	: N/A
This Issue	: 5/25/2007 S.O. No. : N/A	Drawing Revision	: N/A
Prsht Rev.	: NC	Material	: N/A
First Issue	: N/A Type : LANDING GEAR	Due Date	: 6/20/2007 Qty: 1 Um: Each
Previous Run	: 32566		
Written By	:		
Checked & Approved By	: <u>JA 07.05.28</u>		
Comment	: Est Rev:K 95.07.14 ECN 847 & 901; Add Tow Ring and GHW Kit KJ/CP/JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL
Photocopy bluefile & type labels per PPP206-642-212 CHG004

KS 07.06.04 (6)

2.0	32567A	HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
-----	--------	-------------------------------------



Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
D206-642-241 B 32567A

Be

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1
Pick Packing Kit

4.0	D206651041	206 A/B GHW Kit
-----	------------	-----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick: Packing Kit

Qty Part Number	Description Batch
1 D206-651-041 GHW Kit	<u>B 32235</u>
1 D206-642-241(REF)	<u>32567A</u>

Be

5.0	D2652	Bushing
-----	-------	---------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)
Pick: Packing Kit

Qty Part Number	Description Batch
16 D2652	Bushing <u>34074</u>

Be

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:12:52 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32567

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2655

Tow Ring

B 32280

7.0

D26652

Saddle, RH, Fwd,Aft, Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2665-2

Saddle

B 28602

8.0

D26662

Saddle, RH, Fwd,Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 D2666-2

Saddle

B 31297

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

10 D2712

Set Screw

B 33667

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description

Batch

2 D2884

SADDLE SPACER

B 32778

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

B 32626

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:12:52 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32567

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M104625

W

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857

W

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M105057

W

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M104603

W

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M104746

W

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M102079

W

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:12:52 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32567

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD10

Washer *M104885*

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

25 AN960JD416

Washer *M104746*

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer *M104156*

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer *M104537*

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 MS21042L3

Nut (or -3) *M104736*

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

M104248

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 8/18/14
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:12:52 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 32567

Part Number: D206642212

Job Number:



Seq. #:

Machine Or Operation:

Description :

12 MS21042L4 Nut (or -4) _____

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 MS21042L6 Nut (or -6) M104021

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-212

Location: _____

PPP Rev: _____

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 570914

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

25

Date: Friday, 5/25/2007 8:13:49 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 Job Number : 32567A
 Estimate Number : 10163
 P.O. Number : N/A Part Number : D206642241
 This Issue : 5/25/2007 S.O. No. : N/A Drawing Number : D2650 REV E
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : E
 Previous Run : 32566A Material : N/A
 Due Date : 6/20/2007 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : 07.05.28
 Comment : Est Rev:M 04.12.02 Revised procedural steps KJ/JLM

Additional Product

Job Number:



Seq. # Machine Or Operation: Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241

CHG003

N/A

2.0

D2620

Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD

B 32754

BE 07-07-19

3.0

D32861

Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler

B 37592

N 7-8-2

4.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647

Fwd Cap

B 22328

BE 07-07-19

5.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

BE 07-07-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:49 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

BE 07-07-19

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R

Aluminum Rod

m104907

m104221

BE 07-07-19

4-Grind weld flush to cap on top surface only.

BE 07-07-19

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

En 07/08/08

21

Dart Aerospace Ltd
W/O:

WORK ORDER CHANGES

DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:49 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

Handwritten: 7-8-9

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Handwritten: Pm 07-08-09

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Handwritten: BE 07-08-13

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

Handwritten: 7-8-13

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Handwritten: Pm 07-08-13

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number

Description Batch

52 CR3212-4-04

Rivet

Handwritten: m 164537

Handwritten: Pm 07-08-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:49 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B33418

R 7-8-16

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 7-8-16 Time: 9:15

Finish Date: 7-8-19 Time: 10:45

Pick:

Qty Part Number

Description Batch

A/R Sikaflex-291

M104989

Sikaflex expire date:

8-1-1

R 7-8-14

R 7-8-16

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 0708117

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

B31926 (17)

B33214 (1)

BE070819

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B32781 BE0708-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:49 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M104221 BE 07-08-19

2-Grind welds flush as per Dwg D2650. Pr. 07-08-20

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod NONE BE 07-08-27

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

DP 7-8-27

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets 103525

DP 7-8-27

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets 102615

DP 7-8-27

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate R33061

DP 7-8-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:49 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

DP

7-8-27

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/08/27

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/08/29 (41)

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M-H

07/09/10

(1X)

26.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

m105068

FL 07/09/10 (1)

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M-H

07/09/11

(1X)

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B 32465

FL

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B 31889

FL 07/09/12 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:50 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-21

Wearshoe

B24198

FL

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-33

Wearshoe

B32281

FL

32.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B30510

FL

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description Batch

44 ALS4-1032-130 Inserts

or (see QSI 017)

M102475

FL

34.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description Batch

44 AN960JD10L

Washer

M104085

FL 07/09/11 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:50 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 MS27039-1-08

Screw

m 104603

FL

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-1

Plugs

B32576

FL

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-3

O-Rings

B31488

FL

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 MS27039-4-06

m 103993 m 15194

FL

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN960JD416

Washer

m 103558

FL

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

m 104989

FL 07/09/08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:50 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

Sikaflex expire date: 08-01

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

FL 07/09/11 ①

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

131355

FL

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039-1-08 Screw

m104603

FL

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960JD10L Washer

m104885

FL

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

m104989
08-01

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch: m105386

FL 07/09/11 ①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 09/09/14
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 5/25/2007 8:13:50 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 32567A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



8 ml 07 09 12



(1)

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

46.0

QC5

INSPECT WORK TO CURRENT STEP



ml 07 09 12



(1)

Comment: INSPECT WORK TO CURRENT STEP

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location:

PPP Rev:

PPP 32567 6/2/14 (1)

48.0

QC21

FINAL INSPECTION/W/O RELEASE



(1)

Comment: FINAL INSPECTION/W/O RELEASE

D 07/09/14

Job Completion



ll 07-09-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED
06 04 17 *PH*



Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

NOTES


- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 32567A**Copyright © 1997 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

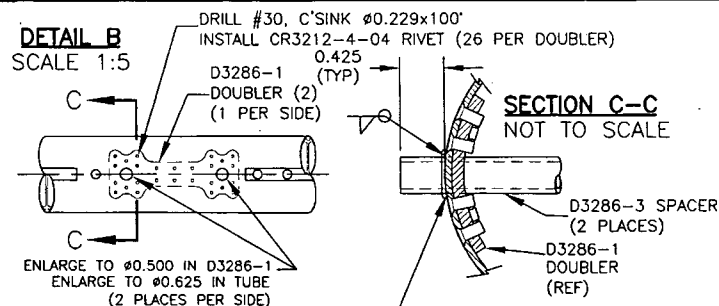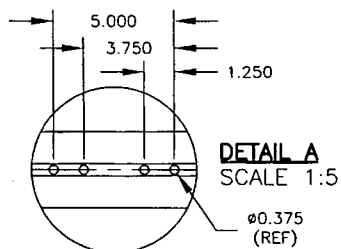



- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO $\phi 0.500$
 4. ENLARGE HOLES IN TUBE TO $\phi 0.625$ AND CHAMFER HOLE $0.030 \times 45^\circ$
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

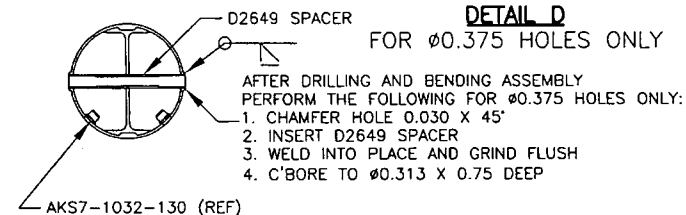

- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR $\phi 0.375$ HOLES ONLY:
1. CHAMFER HOLE $0.030 \times 45^\circ$
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO $\phi 0.313 \times 0.75$ DEEP

RELEASED


06.04.17

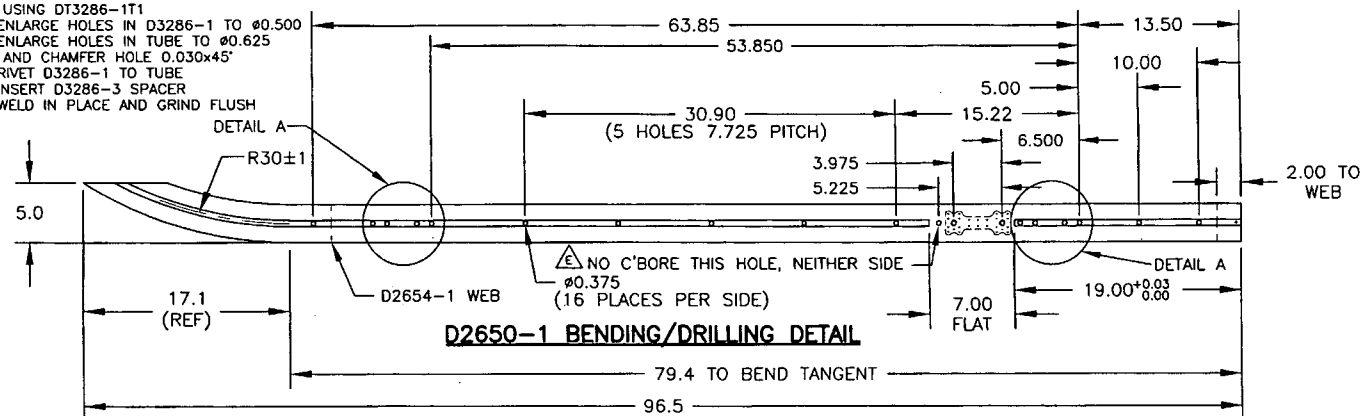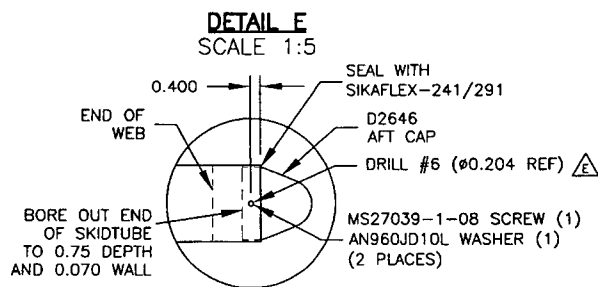


DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

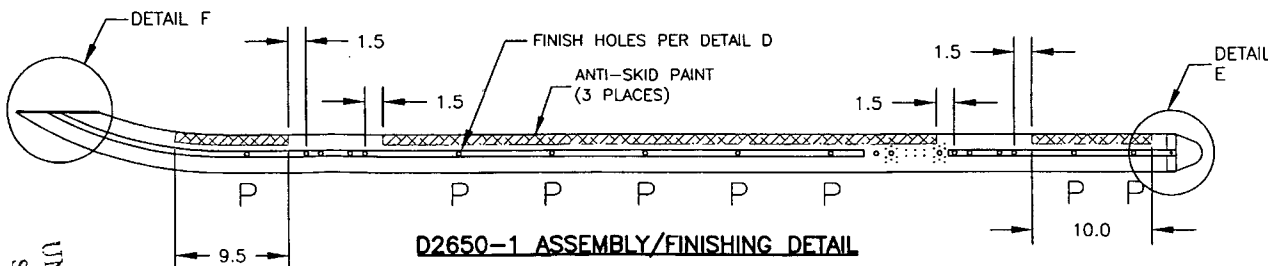



D2650-1 ASSEMBLY/FINISHING DETAIL

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	CP	DART DART AEROSPACE USA, INC.	REV. E
CHECKED	PH	APPROVED	PH	DART	SHEET 2 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
7A

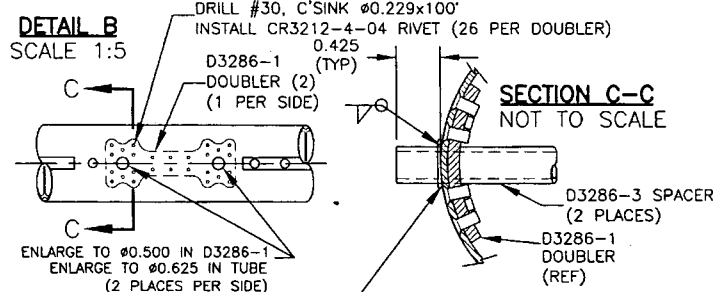
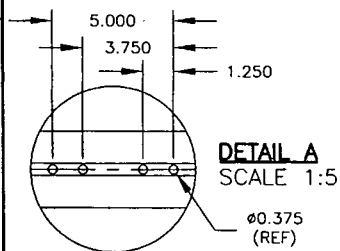


- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN. FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO Ø0.500
 4. ENLARGE HOLES IN TUBE TO Ø0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

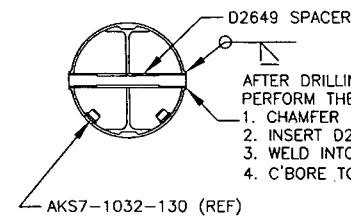

- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO Ø0.313 X 0.75 DEEP



RELEASED

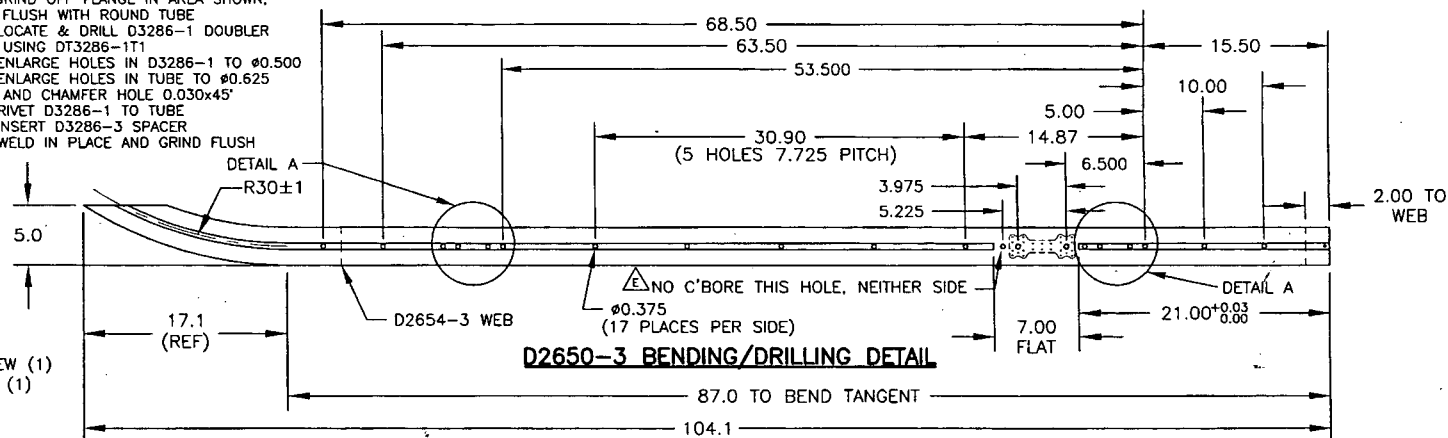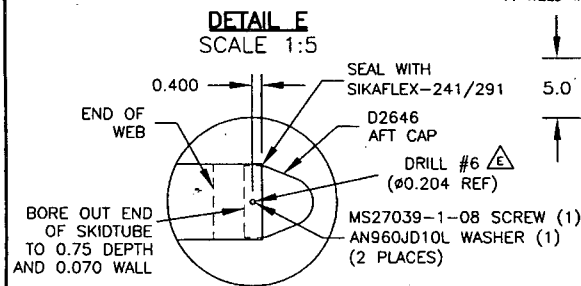

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

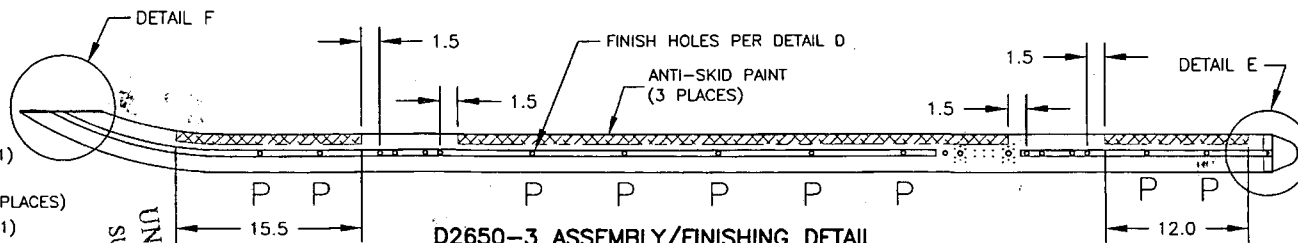

NO WORK ORDER
2680-7A
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	UP	DRAWN BY	UP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	UP	DRAWING NO.	REV. E
		DATE	06.03.30			D2650	SHEET 3 OF 5
						TITLE	SCALE
						SKIDTUBE	1:10

DART		DART AEROSPACE USA, INC. PORT HADLOCK, WA	
DRAWING NO.		REV. E	
D2650		SHEET 4 OF 5	
TITLE		SCALE	
SKIDTUBE		1:10	

RELEASE

NO. 123

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Bradley Elliott
Joint Welding Procedure TIG
Part number and Job number A20664224/16330804

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS TIG
Penetration Complete ☐ Partial ☒
Current AC ☒ DC ☐ Single Weld ☒ Double Weld ☐
Backing YES ☐ NO ☒

	Position	Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>			
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>	
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>	
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>	
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>	
Crossbolt Spacer Welded into		Skidtube			

TEST RESULTS


 
Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/08/20 Qualifier Paul A. Auld

Date: Thursday, 11/10/2007 2:26:44 PM
 User: Linda Lacelle

Process Sheet

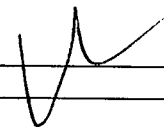Customer : CC-DAR01 Dart Aerospace Ltd.	Drawing Name : D206-642
Job Number : 35132	
Estimate Number : 10804	
P.O. Number :	Part Number : Z_CUSTOM
This Issue : 11/10/2007 S.O. No. :	Drawing Number : ECN 1046-PAPERWORK
Prsht Rev. : NC	Project Number :
First Issue : / / Type : LANDING GEAR	Drawing Revision :
Previous Run : 00015	Material :
Written By : 	Due Date : 18/10/2007 Qty: 1 Um: Each
Checked & Approved By : 	
Comment :	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1
 REMOVE FROM STOCK:

D206-642-111	15614	15615
D206-642-112	10319	25504
D206-642-141	9575	18613
D206-642-211	33078	32559 - 32565 - 33775 - 33776
D206-642-212	32257	32567 - 32568 - 32568 - 33079 - 33080 - 33242
D206-642-213	19735	
D206-642-214	24414 - 24484	28083 - 29084 - 32983 - 32984
D206-642-241	28097 - 28604	33211 - 33342
D206-642-311	28847	
D206-642-312	29741	15619 - 29742 - 29744
D206-642-341	34557	34056 - 34555 - 34556 - 32495 - 31980
D206-642-411	34132	
D206-642-411BL	34564	34563 - 34562 - 34060 - 34059 - 32502 - 31058
D206-642-412	34135	
D206-642-412BL	31066	30940 - 30260 - 30265 - 24239
D206-642-441	34521	34579 - 33848 - 34581
D206-642-511	34586	34584 - 34583
D206-642-512		
D206-642-513		
D206-642-514		
D206-642-541		
D206-642-611		
D206-642-612		

ADD NEW PAPERWORK EASA.IM.R.S.01320 REV.1
 PER ECN 1046

1-11-09 SP